
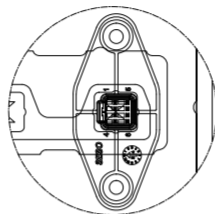
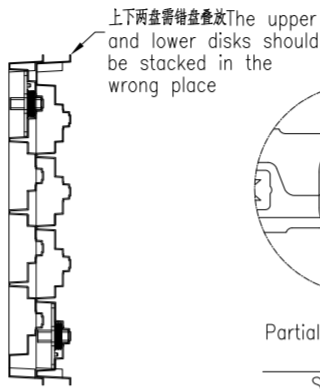
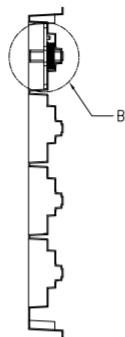



RoHS

本产品符合我司QA-3-04-005
环境管理物质标准规范

包装图

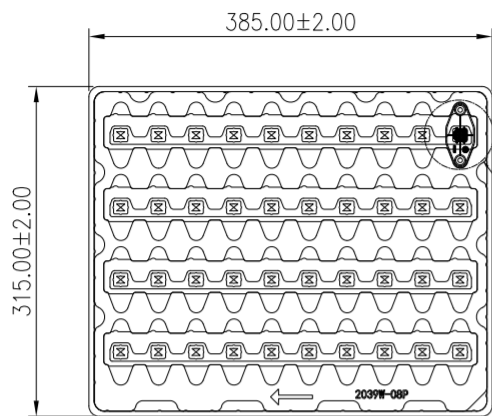

Partial enlarged detail
局部放大图A
Scale比例 3:1

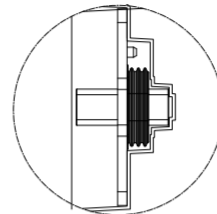


Partial enlarged detail
局部放大图B
Scale比例 3:1


Applicable Product No. 适用产品料号	2039W-G0809-05H00
----------------------------------	-------------------

Poles Pin位	Pcs/Tray Pcs/盘	Tray/Carton 盘/箱	Pcs/Carton Pcs/箱
2*04	40	12	480

Step步骤1:

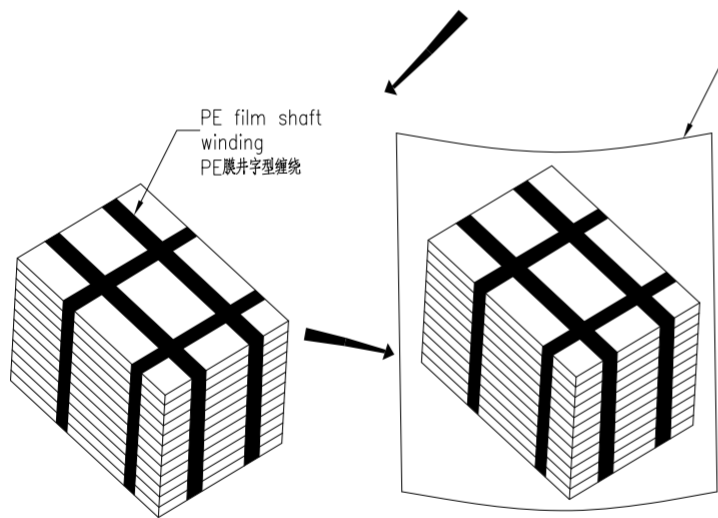

VCI bag VCI袋
Drier干燥剂放两包共10g

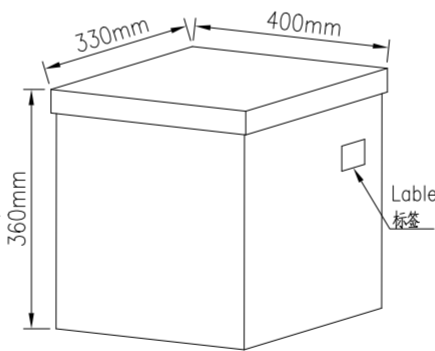

Step步骤2:

Step步骤3:

Step步骤4:

Packing step包装步骤:

步骤1: 将检验好的良品硅胶圈朝下, 整齐并方向一致地摆放入吸塑盘, 不可少数。

Step 1: Put the Silicone ring of the tested good product down, neatly and in the same plastic direction into the plastic tray, not a few. Specification of the uptake plastic tray: 2039SP-3850*3150*320

吸塑盘规格: 2039SP-3850*3150*320

Step 2: Overlap the uptake plastic tray, When it overlaps, adjacent upper and lower tray need to be rotated 180 degrees for stacking. One empty uptake plastic tray is stacked together in every 9 products, and put one on the top layer as well, fold them up into a bundle, then cross and parallel wrap with PE film.

步骤2: 将吸塑盘重叠, 在重叠吸塑盘时, 相邻上下两盘需要旋转180度堆叠, 每12盘产品加最顶层放1PCS空吸塑盘叠起来为1扎, 然后用PE膜井字型缠绕。

Step 3: Wrap 1 bundle of PE film wrapped products with VCI bag, and put in 2 packs of desiccant, seal it.

步骤3: 将PE膜捆好的1扎产品套上VCI袋, 并放入2包干燥剂, 封口。

Step 4: Then put it into a carton, seal it with transparent tape, and attach the outer carton label.

步骤4: 然后放入纸箱, 用透明胶带封箱, 贴上下箱标签。

Note: when the carton is not full, filling material is required, cannot shake too much.

注: 不满箱时, 需使用填充物, 不可晃动太大。

Carton size: CB-400*330*360KK-01

纸箱规格: CB-400*330*360KK-01

Carton material: K=K; Carton thickness: 6~7mm

纸箱材质: K=K; 纸箱厚度: 6~7mm

一般公差

.X ±0.35

.XX ±0.25

.XXX ±0.15

X: ±2°

视角

视角

SMS 东莞市思索技术股份有限公司
Dongguan SESO Technology Co., Ltd.

核准	审查	制作	日期
杨蒙	陈乐威 杨梅	程纳	20240830

图号:
PK-2039W-G0809-05H00

名称:
2.00mm Pitch Connector Packing

单位	比例	页次	版本	编号
mm	1:1	1/1	X0	A-000

日期 版次 变更编号 变更内容说明

变更人 核准